

## 1-Component Adhesives and Sealants

## **Contact Cyanoacrylate Adhesives**

# VM 20 Cyanoacrylate Adhesive




## Cyanoacrylate adhesive for metals | low viscosity | very fast curina

WEICON Contact VM 20 is suitable for all types of metal bonds, especially for the bonding of precisely fitted parts in serial production. Contact VM 20 can be used in the metalworking industry, in machine construction, in housing and apparatus engineering and in many other applications.

#### Characteristics

Characteristics		
Base		methyl
Texture		liquid
Colour after curing		colourless
Silicone-free		yes
Processing		
Processing temperature		+15 °C to +40 °C
Relative air humidity		40% - 70%
Viscosity		20 -40 mPa⋅s
Density	(+20 °C)	1,1 g/cm <sup>3</sup>
Gap bridging up to	max.	0,1 mm
Curing		
Initial adhesion in	seconds (shear strength: 0,	5 MPa)
- measured at		23 °C and 50 % relative humidity
on aluminium sandblasted		5-10 sec.
on ABS untreated		80-100 sec.
on rigid P	VC	5-6 min.
Final strength	(100 % strength)	24 h
Mechanical prope	erties after curing	
Shear strength acc	cording to DIN EN 1465	
Steel sandblasted		9-25 MPa
Aluminium sandblasted		6-19 MPa
Rigid untreated PVC		12 MPa
Untreated ABS		6-11 MPa
PC (polycarbonate)		5-12 MPa

Thermal parameters				
Temperature resistance		-50°C to +80°C, briefly up to +100°C		
Softening temperature		+150 °C		
Refraction index		~ 1,49 nD20		
Thermal expansion coefficient		~ 80 x 10^-6 m/(m·K)		
Thermal conductivity	DIN EN ISO 22007-4	~0,1 W/m·K		
Electrical parameters				
Resistance	DIN IEC93	>10^15 Ω·cm		
Dielectric strength		~ 25 kV/mm		
Approvals / Guidelines				
ISSA Code		75.530.15		
IMPA Code		812967		
MIL-Spec	comply with	MIL-A-46050C Type I Class 1		

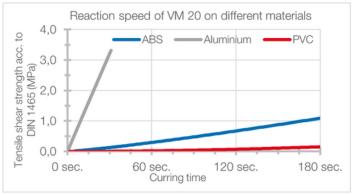

#### Instructions for use

When using WEICON products, the physical, safety-related, toxicological and ecological data and regulations in our EC safety data sheets (www.weicon.com) must be observed.

## Surface pre-treatment

successful application of WEICON Contact Cyanoacrylate Adhesives depends on the thorough preparation of the surfaces. This is the most important factor for overall success. Dust, dirt and moisture or wetness have a negative impact on the adhesion.

Therefore, before processing WEICON Contact Cyanoacrylate Adhesives, the following points must be observed: For a flawless adhesive bond, adhesive surfaces must be clean and dry (clean and degrease with WEICON Surface Cleaner). Smooth surfaces should be roughened mechanically. To improve the adhesion of plastics that are difficult to bond (e.g. PE, PP, POM, PTFE), thermoplastic elastomers (TPE) and silicones, WEICON CA-Primer can be applied to the bonding surface.

## Contact Primer for Polyolefines

Without pre-treatment, many plastics cannot or can only be bonded under certain conditions. When these plastics are pre-treated with WEICON Contact Primer, their surface structure changes. This makes it possible to bond plastics

The specifications and recommendations given in this technical data sheet must not be seen as guaranteed product characteristics. They are based on our laboratory tests and on practical experience. Since individual application conditions are beyond our knowledge, control and responsibility, this information is provided without any obligation. We do guarantee the continuously high quality of our products. However, own adequate laboratory and practical tests to find out if the product in question meets the requested properties are recommended. A claim cannot be derived from them. The user bears the requested properties are recommended. A claim cannot be derived from them.

phone +39 (0) 010 2924 871

WEICON Romania SRL phone +40 (0) 3 65 730 763

WEICON SA (Pty) Ltd South Africa phone +27 (0) 21 709 0088 info@weicon.co.za

WEICON South East Asia Pte Ltd ne (+65) 6710 7671

WEICON Kimya Sanayi Tic. Ltd. Sti Turkey phone +90 (0) 212 465 33 65



1-Component Adhesives and Sealants

# VM 20 Cyanoacrylate Adhesive

that are otherwise difficult to bond, e.g. polyethylene (PE) and polypropylene (PP) from the polyolefine group. Even modern thermoplastic elastomers (TPE), PTFE and related plastics as well as silicones can be bonded, when pre-treated with WEICON Contact Primer.

### **Processing**

The products are supplied ready for use. Depending on the form of delivery, they can be processed by hand directly from the container or with appropriate dosing equipment. Apply WEICON Contact Cyanoacrylate Adhesive to just one of the bonding surfaces. The layer thickness when applying the adhesive should be between min. 0.05 mm and max. 0.2 mm, as otherwise complete curing cannot be guaranteed. For large-surface bondings, WEICON Contact Cyanoacrylate Adhesives should be applied in dots in order to prevent inner tensions. WEICON Contact Cyanoacrylate Adhesives are very economical. One drop is sufficient for an adhesive area of 3 to 5 cm².

#### Curing

After applying the product, the parts to be bonded must be joined quickly and fixed if possible, since the curing of the products has already started as a result of the humidity in the ambient air or condensed on the bonding surfaces. The components should be bonded at a relative air humidity level between 40 % and 70 %. Below 40 %, the curing process is slowed down significantly or even prevented altogether. At an air humidity level above 70 % or with strongly alkaline substrates (e.g. glasses), there is a risk of shock curing. In these cases, certain materials show a drop in strength by 10 % to 15 % due to tensions in the adhesive layer. Alkaline surfaces (pH value >7) accelerate the curing process, acidic surfaces (pH value <7) slow down the curing process and can prevent polymerisation altogether in extreme cases. If curing is delayed or disturbed by factors such as a too wide adhesive gap, porous or acidic surface, the use of WEICON Contact Activator is recommended.

### **WEICON Contact Activator**

The activator speeds up the curing process of WEICON Contact Cyanoacrylate Adhesives. When applied to absorbing surfaces, e.g. wood or foam etc., and all chemically-treated surfaces, e.g. zinc galvanized metals etc., the activator's effectiveness lasts approx. one minute. On non-absorbent surfaces, the activator's effectiveness lasts up to approx. 12 hours. Use is recommendable with:

- highly viscous WEICON Contact types
- large thickness of the adhesive layer
- · absorbing and porous surfaces

## Contact Cyanoacrylate Adhesives

- passive materials (alkaline surfaces, like for example zinccoated metal parts)
- disadvantageous environmental conditions (low temperatures, low air humidity < 30 %).

### **Storage**

WEICON Contact Cyanoacrylate Adhesives have a shelf life of at least 9 months, when stored in unopened condition at room temperature (+18 °C to +25 °C) in a dry and dark space. Temperatures of approx. +5 °C will increase the shelf life to 12 months.

#### Scope of delivery

Adhesive

#### Accessories

10024317	Surface Cleaner, 150 ml, transparent
10024313	Surface Cleaner, 400 ml, transparent
10000282	CA-Activator Spray, 150 ml
10033805	CA-Activator Spray AC, 150 ml
10000275	CA Primer for Polyolefines, 10 ml
10000278	CA Primer for Polyolefines, 100 ml
10068262	Dosing Tip, 1 PCE
10068261	Dosing Tip, 1 PCE
10012382	Contact Filler, 30 g, transparent
10063106	Contact Filler, 30 g, black
10059034	CA-Remover, 12 ml
10051358	CA-Remover, 30 ml
10010887	Processing Spatula, 1 PCE
	- · · · · · · · · · · · · · · · · · · ·

#### **Available sizes**

10000254	VM 20 Cyanoacrylate Adhesive, 0,5 kg
10019853	VM 20 Cyanoacrylate Adhesive, 30 g
10019857	VM 20 Cyanoacrylate Adhesive, 60 g

#### **Conversion table**

$(^{\circ}C \times 1.8) + 32 = ^{\circ}F$	Nm x 8.851 = lb⋅in
mm/25.4 = inch	Nm x 0.738 = lb·ft
$\mu$ m/25.4 = mil	Nm x 141.62 = oz∙in
N x 0.225 = lb	mPa⋅s = cP
$N/mm^2 x 145 = psi$	$N/cm \times 0.571 = Ib/in$
MPa x 145 = psi	$kV/mm \times 25.4 = V/mil$

To the product detail



page:

Note
The specifications and recommendations given in this technical data sheet must not be seen as guaranteed product characteristics. They are based on our laboratory tests and on practical experience. Since individual application conditions are beyond our knowledge, control and responsibility, this information is provided without any obligation. We do guarantee the continuously high quality of our products. However, own adequate laboratory and practical tests to find out if the product in question meets the requested properties are recommended. A claim cannot be derived from them. The user bears the only responsibility for non-appropriate or other than specified applications.